

Ultron Carbonite 9.2.2

- Release Date: April, 2026.



Important: Please review the **End User Software License Agreement** before installing or using this software.



Important: Ultron™ 4.8.0, or higher, requires Ultron Carbonite version 7.0.0, or higher.

Feature Enhancements

A number of features have been added, or updated, to this version of software. This section provides a brief introduction to these features, and how to use them.

v9.2.2 Features

No New Features

This version of software fixes a number of bugs and does not introduce any new features.

v9.2.1 Features

MaxLicense Support


The MaxLicense (CHMFR-ADD-MAXLIC) is a universal license that can be applied to any supported Carbonite product to provide two (2) fully functional ME layers to the switcher. This will be similar to the ADD-ME2 option.

Tip: If the MaxLicense is requested from Ross Platform Manager it can be dynamically releases and redeployed to another switcher as needed.

Note: The CHMFR-ADD-MAXLIC license must be renewed with CHMFR-ADD-MAXLIC-SM every year to be entitled to new software updates.

TD Modular Memory Panel Support Expanded

Support has been expanded for the TD 4882AR Series Rev02 Modular Memory Panels to include the TD2S, TD3S, TD3, TD4, TDx3, and TDx4. In this configuration, the memory module is located on the far right on the bottom row.

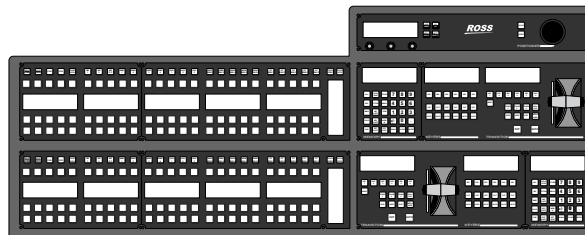

Tip: Some existing panel can be upgraded to this configuration with a hardware option.

Panel Xpt Memory Store Personality Option

A Personality option was added that allows you to hide the memory function source (mnemonic) buttons (**EFF DISS**, **MEM AI**, **PGM**, **INCLUSIONS**, **STORE**) on TouchDrive control panel.

Rosstalk Chroma Key Recall

The Rosstalk command for memory recalls has been expanded to include chroma key keyers.

For example, **MEM 29 : CK : 2** recalls memory 9 on bank 2 of Chroma Key 2.

New Devices Supported

No new device support or commands were added to this version of software.

New Devices

No new devices were added or updated for this version of software.

New/Updated Commands

No new commands were added or updated for this version of software.

Bugs Addressed

The following bugs were addressed in this version of software:

- CR-6360 — Fixed an issue where long set names were not being displayed correctly on the 3-knob menu of the Carbonite Black panels.



- CR-6499 — Fixed an issue where switcher source names were not being shown when a long TSL name was assigned to the source.
- CR-9182 — Fixed an issue where simultaneously pressing two mnemonic displays on the same module, or segment, on a TouchDrive Panel caused the key bus selection to change unexpectedly.
- CR-9291 — Fixed an issue where the custom control DVE Param with different parameters failed to update the Value box.
- CR-9308 — Removed erroneous "SSD" label appearing in the 3-knob menu as a Media-Store location.
- CR-9341 — Fixed an issue where in UHDTV1 the MiniME™ keyer menus were unavailable in DashBoard.
- CR-9441 — Fixed an issue with LTC drop-frame reporting.
- CR-9470 — Fixed an issue where audio output from the MultiViewer was distorted.
- CR-9672 — Fixed an issue where the Clip Player was outputting pink video.
- CR-9733 — Added CPLD compatibility information to the status page of DashBoard.

Known Issues and Limitations

Keep these notes in mind when upgrading your system to this version of software. Contact Ross Video Technical Support if you have any questions about performing a software upgrade.

Operational Notes

The following issues have been identified when working with the switcher:

- **Corrupt USB** — If you remove the USB drive while the switcher is writing to it, the USB could become corrupted and will need to be re-formatted.
- **External Re-Entry Video Errors** — A video timing error can occur when a video output of the switcher is routed back into the switcher using an input BNC. If video timing errors do occur, assigning a frame

synchronizer to the input BNC will remove the timing errors.

- **Stills with same Name** — You cannot have two or more Media-Store files with the same name but different file extensions in the same folder. The switcher treats capital and lowercase letters as the same.
- **Transitions with Show Alpha** — If the show alpha feature is on, only cut transition are possible on the ME. The switcher will perform a cut at the end of the transition duration instead of the selected transition type.
- **Ultrix™ Reference** — When you change the switcher mode, the format and frequency the switcher is operating in change. You must update Ultrix™ to send a compatible reference signal to the switcher.
- **Missing Audio on Video Mode Change** — If you have a media item with audio loaded into a Media-Store channel and change the video mode the switcher is operating in, the audio will stop playing. You must unload and re-load the media item for the audio to play normally again.
- **720p in BT.2020 SDR** — The combination of 720p and the BT.2020 color gamut in SDR is not documented in the applicable standards and may not be supported by other downstream devices.
- **Sets Not Backwards Compatible** — If you save a set in one version, you may not be able to load the set in an older version of switcher software.
- **Incorrect Dynamic Range and Color Gamut PID** — The 4 output HD-BNCs on the SDPE will always carry the SDR BT.709 PID, even if the actual video has been changed. The output video will be in the correct color space but may carry the incorrect PID.
- **Decimal Accuracy** — DashBoard and the 3-knob menu show numerical values slightly differently. DashBoard shows values accurate to 2 decimal places and the 3-knob menu shows values rounded to 1 decimal place.

- **Jumbo Frames Not Supported** — Ethernet frames with more than 1,500 bytes of payload (Jumbo Frames) are not supported at this time. If your device has an option to send jumbo frames, it must be turned off to properly communicate with the switcher.
- **Outputs 17 and 18 Do Not Have Audio** — Outputs 17 and 18 from the switcher (Aux A and B) cannot have audio routed to them in Ultrix™.
- **MediaWipe and DVE Wipe** — If you switch back and forth between a DVE transition and a MediaWipe DVE transition, the DVE transition may only perform a cut at the end of the transition duration. Select a different DVE transition pattern and then switch back to the pattern you want to fix the issue.
- **Wrong Color Gamut PID in UHDTV1** — If the switcher is operating in UHDTV1 and BT.2020, with Ultrix™ 5.2, Ultrix™ will report BT.709.
- **Can't Recall Memory Without Inclusions** — The ability to store or recall a memory without inclusions to recall just a Media-Store or Aux bus is not available. If you need a memory to recall just a Media-Store or Aux bus, you must include a sacrificial inclusion, such as a chroma key.
- **Pink MultiViewer** — The output of the MultiViewer will display pink if external and internal sources are mixed on the same row on the MultiViewer layout when the switcher is operating in UHDTV1. Arrange all internal or external sources on the same layout row.

Security & Network Vulnerabilities

The following exploits have been identified:

- **CVE-2024-6387: Remote Unauthenticated Code Execution Vulnerability in OpenSSH server** — At this time this exploit is only theoretical for 64-bit operating systems such as that used in Ultrix Carbonite.

Software Upgrade

The switcher software is upgraded from DashBoard either by dragging and dropping the software onto the Upgrade page, or by saving the upgrade file to the USB drive inserted in the frame.

Depending on the version of software you are upgrading from, your menus may be arranged or appear differently.

Note: Contact Ross Video Technical Support for information on upgrading Ultrix™.

Software Upgrade Matrix

The following tables show supported upgrade paths for the recent versions.



Important: For Recovery Upgrades, it is important to contact Ross Technical Support for the version of Recovery Upgrade you need.

Table 1: Supported Ultrix Carbonite Upgrades (SDPE v1)

Current	Upgrading to...		
	Ultrix Carbonite	HyperMax	Mosaic
Ultrix Carbonite			
9.0.0	9.1.0 +Higher	11.1.0 +Higher	2.0.0 +Higher
9.1.0			
9.1.6			
9.1.10			
9.1.14			
9.2.1			
9.2.2			
HyperMax			
11.0.1	9.0.0 +Higher	11.0.1 +Higher	2.0.0 +Higher
11.0.2			
11.1.0			
11.2.0			

Current	Upgrading to...		
	Ultrix Carbonite	HyperMax	Mosaic
Mosaic			
2.0.0	9.0.0 +Higher	11.1.0 +Higher	2.0.0 +Higher
2.1.0			

Table 2: Supported Ultrix Carbonite Upgrades (SDPE v2)

Current	Upgrading to...		
	Ultrix Carbonite	HyperMax	Mosaic
Ultrix Carbonite			
9.1.14	9.1.14 +Higher	11.1.0 +Higher	2.1.0 +Higher
9.2.1			
9.2.2			
HyperMax			
11.0.1	9.1.14 +Higher	11.0.1 +Higher	2.1.0 +Higher
11.0.2			
11.1.0			
11.2.0			
Mosaic			
2.1.0	9.1.14 +Higher	11.1.0 +Higher	2.1.0 +Higher

Software Compatibility

Before installing any software, review the following version compatibility information.

Note: Compatibility, unless otherwise indicated, shows the combination of software versions that were tested together. Other combinations may not have all the features introduced with the most recent version of software.



Important: Ultrix™ 4.8.0, or higher, requires Ultrix Carbonite version 7.0.0, or higher.

Table 3: Version Compatibility

Product	Version	To Verify
Carbonite	9.2.2	The current version is shown on the Status tab in DashBoard.

Product	Version	To Verify
Ultrix FR12	7.2.0 (or higher)	The current version is shown on the Product tab of the System Status node in DashBoard.
Ultrix FR5	7.2.0 (or higher)	The current version is shown on the Product tab of the System Status node in DashBoard.
Ultrix FR2	7.2.0 (or higher)	The current version is shown on the Product tab of the System Status node in DashBoard.
Ultrix BCS	7.2.0 (or higher)	The current version is shown on the Product tab of the System Status node in DashBoard.
DashBoard	9.16.1	Refer to the documentation that came with DashBoard for information on getting the current version number.
Carbonite Black Panel	1.5.530	A software mismatch message is shown on the control panel if you need to upgrade the software on the control panel.
TouchDrive Panel	3.3.1	The current version is shown on the Status page in DashBoard for the TouchDrive node.

Hardware Compatibility

Before upgrading or downgrading your switcher, review the following hardware compatibility information.



Important: Ultrix Acuity does not support the SDPE Rev02 (4842AR-012-02) at this time.

Table 4: Hardware Compatibility

Version	Hardware
9.1.14 or higher	• 4842AR-012-02 — SDPE Rev02 blade

To Upgrade the Switcher Software

Use DashBoard to upload the upgrade file to the switcher.

Note: Save your switcher setup information to a set on a separate USB drive before upgrading. This switcher set can be used as a backup in case there is a critical error during the upgrade.


Tip: Switcher sets are not backwards compatible. Keep an archive copy of your sets in case you want to downgrade to the previous software version.



Important: Do NOT turn the switcher power off during the upgrade. Doing so may corrupt the switcher software or damage the switcher components.

Tip: Insert a USB drive into the USB Port on the switcher. Although not required for the upgrade, the switcher copies the system logs to the USB before the upgrade. This information can be useful for Technical Support if there is an issue with the upgrade.


1. Click **Navigation Menu > Configuration > System > Upgrade.**

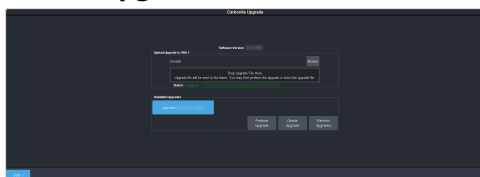

2. Locate the software upgrade file (upgrade-x.x.x.xxxx.ul tx_carb) for the switcher.

Tip: You can store the upgrade file to the USB in the switcher without upgrading. For example, you can upload the regular and Mosaic upgrade files to the USB so that you can quickly switch between them.

3. Drag and drop the upgrade file into the **Drag and Drop Upgrade** area on DashBoard. The file is uploaded and you are asked what you would like to do with the file.

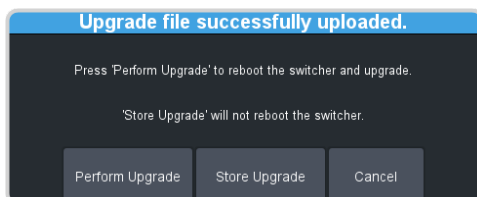

- **Perform Upgrade** — perform the upgrade with the file that was just uploaded.
- **Store Upgrade** — store the file locally in the upgrade folder.
- **Cancel** — cancel the process and delete the upgrade file from the switcher.

Tip: You can also upgrade from the USB. All upgrade files located on the USB are shown listed. Click the file you want to use and click **Perform Upgrade.**

Tip: You can also upgrade by clicking **Browse**, locating the upgrade file, and then clicking **Upload File.**

Tip: You can delete an upgrade file by selecting the file and clicking **Delete Upgrade.**

4. Click **OK** to confirm the upgrade.
5. Wait for the DashBoard pages to come back up. This may take a few minutes.
6. Restart router to ensure proper communications between the switcher and router.

Upgrade Issues

If there is a problem during the upgrade procedure, an error message is shown on the display of the control panel.

Table 5: Upgrade Error Messages

Error Message	Description
USB not inserted	The USB drive was removed or unmounted during the upgrade. Re-insert the same USB drive back into the frame.
USB < 1G free	The USB drive requires at least 1GB of free space for temporary files during the upgrade. Copy the upgrade file to a larger USB drive and start the upgrade again.
USB failure	There has been a critical failure with the USB drive. A forced upgrade must be performed and switcher setting will have to be restored from the saved setup. Contact Ross Technical Support for support with this error.
USB file failure	There has been a critical failure with the files on the USB drive. A forced upgrade must be performed and switcher setting will have to be restored from the saved setup. Contact Ross Technical Support for support with this error.

To Upgrade the Carbonite Black Panel

After the frame has been upgraded and reconnected to the panel, a message may be displayed indicating that a software mismatch. You only need to upgrade the panel or CarboNET if the mismatch message is displayed.

Note: It is important to upgrade all devices connected to a frame to the same version. This includes in a MultiPanel configuration.

1. In DashBoard, double-click on the **CarbonitePanel** node for the Carbonite Black panel or CarboNET that you want to upgrade.
2. Click **Upload > Browse**.
3. Locate the CarbonitePanel-v#_#_###.bin upgrade file and click **Open**.

*Tip: If you have multiple devices to upgrade, click **Next** and select all the devices that you want to upgrade.*

4. Click **Finish**.
DashBoard uploads the upgrade file to the device and performs the upgrade.
5. Click **Reboot > OK**.