



## Software Release Notes: **Tria | Mira**

Software Version: **V7.1.13**

Previous Version: **V7.1.6**

Document Revised: November 04, 2020

### V7.1.13 Software

- Features | **Mira | Mira+ | Mira Express** |
  1. **Mira Replay App:** Added integration of Ross PIERO sports graphics analysis system with all Mira replay systems.
  2. **Mira Replay App:** Changed default softkey menu for Mira Control Surface when entering Playlist Edit mode—so camera angles are now presented first. Double-tap SHIFT button to switch to Playlist editing softkeys.
- Bug Fixes | **ALL Tria** Products | **ALL Mira** Products |
  1. **Products with AVC-Intra Video Hardware:** fixed rare issue in which AVC-Intra video hardware would *sometimes* not initialize at O/S restart and/or at power-on, resulting in ‘no video channels’.

### V7.1.12 Software

- Bug Fixes | **ALL Tria** Products | **ALL Mira** Products |
  1. **Media File Import App:** Improved compatibility of certain media files codecs and wrappers during media file import transcoding while using the FFmpeg codec libraries.

### V7.1.11 Software

- Bug Fixes | **Mira | Mira+ | Mira Express** |
  1. **Mira Replay App:** Corrected an issue which could cause Mira Control Surface control panel to become unresponsive after 2 to 3 hours (*or more*) of continuous operation.
  2. **Mira Replay App:** Corrected very rare JOG playback issue: when Rotary Dial stops spinning, the PGM playout channel sometimes would not stop moving.
- Bug Fixes | **Tria News** |
  1. **Software Installer:** Corrected issue with Tria News *software installer* when installing Tria News software onto video server with brand-new installation of Windows 10 LTSC operating system.

## V7.1.10 Software

- Features | **Tria Express** | **Tria News** | **Mira Express** |
  1. **New Motherboard:** The motherboard for the 2RU chassis video/replay server systems was migrated to a new model. This software version adds support for this new motherboard.

## V7.1.9 Software

- Bug Fixes | **Tria News** |
  1. **Tria Explorer App:** Corrected issue in which only a finite number of clips could be loaded and played in video channels—requiring a Tria News restart to continue clip load operations.

## V7.1.8 Software

- Skipped & Unreleased Software Version

## V7.1.7 Software

- Features | **Tria News** |
  1. **Tria Config App:** Changed default video channel assignments for the two physical RS422 ports. Applies only to the Tria News product.

END of DOCUMENT